

UT306C

Infrared Thermometer User Manual

Overview

UT306C infrared thermometer (hereinafter referred to as the thermometer) can quickly and accurately determine the surface temperature of the target by measuring the infrared energy radiated by the target surface, which is suitable for non-contact temperature measurement. UT306C is a thermometer with a D: S ratio of 12:1.

 
Safety Instructions

⚠ Warning:

In order to prevent eye damage or personal injury, please read the following safety instructions before using the product:

- Do not point the laser directly at persons or animals or indirectly through reflective surfaces.
- Do not look directly at the laser or with optical tools (binoculars, microscopes, etc.).

LASER RADIATION
DO NOT STARE INTO BEAM
CLASS 2 LASER PRODUCT
λ=630-670nm, <1mW



Cautions:

- If the laser irradiates the user's eyes, please close the eyes immediately and turn the head away.
- Do not disassemble or refit the product and laser without permission.
- To ensure its safety and accuracy, this product should only be repaired by professional maintenance personnel using original replacement parts.
- Replace the batteries when the low battery indicator shows to prevent incorrect measurements.
- Please check the product before using it. If it is damaged, cracked on the surface or missing plastic parts, do not use it.
- Please refer to the emissivity information for the actual temperature. Highly reflective objects or transparent materials will make the actual temperature higher than the measured temperature. When measuring these objects, pay attention to the risk of burns.
- Do not use the product in an environment with flammable and explosive liquid, gas or dust.
- Do not use the product around the environment with steam, dust, or large temperature fluctuations. It may bring inaccurate results and risks.
- Put the product in the current environment for more than 30 minutes before using it to ensure measurement accuracy.
- Do not leave the thermometer on or near objects of high temperature.

Technical Indexes

Model	UT306C
Optical resolution	12:1 (calculated at 95% energy)
Measurement range	-50°C~500°C (-58°F~932°F)
LCD size	25*26mm
LCD display	Color EBTN
Accuracy	-50°C~0°C: ±(2°C+0.1°C/°C) 0°C~500°C: ± 2°C or ± 2% (whichever is greater)
	-58°F~32°F: ± (4.0°F+0.1°F/°F) 32°F~932°F: ± 4.0°F or ± 2% (whichever is greater)
Temperature index	±0.1°C/°C or ±0.1%/°C whichever is greater (±0.1°F/°F or ±0.1%/°F whichever is greater)
Repeatability	±0.5°C or ±0.5% whichever is greater (1°F or 0.5% whichever is greater)
Emissivity	0.1~1.0 (adjustable, 0.95 by default)
Response time	≤250ms (95% of reading)
Spectral response	8μm~14μm
Auto power off	15s
Low battery indication	✓
High/low temperature sound alarm	✓
Data hold	✓

Unit conversion (°C/°F)	✓
MAX/MIN/AVG/DIF	✓
Lock measurement	✓
Laser	Ring laser, wavelength: 630nm~670nm, output power<1mW, type: class 2
Operating temperature	0°C~50°C (32°F~122°F)
Storage temperature	-20°C~60°C (-4°F~140°F)
Operating humidity	<90%RH (non-condensing)
Drop proof	1m
Battery type	2*AAA (zinc-manganese batteries)
Battery life	≥6h (continuous measurement mode with laser and backlight on)
Product color	Red + grey
Product weight	161.5g
Product size	146×94.5×46mm

Safety Standards

CE certification: EN61326-1 EN61326-2-3

Safety standards of laser products: IEC/EN 60825-1, EN 50689.

Reference Standard


JJG 856-2015

Characteristics

- 1) With ring laser, making the measurement indication area more accurate
- 2) Bright, easy-to-read and high-contrast color EBTN display
- 3) MAX/MIN/AVG/DIF hold
- 4) With buzzer sound alarm, can quickly find abnormalities
- 5) Trigger lock, suitable for processes that require temperature monitoring
- 6) Short press the "🔒" button in shutdown mode to take a measurement

Appearance

1	Laser
2	Infrared receiving window
3	Trigger
4	Battery door
5	LCD display
6	LOCK button
7	MODE button
8	LASER button
9	Laser warning label

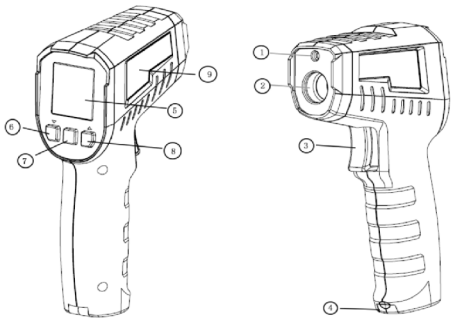

LCD Indicators

🔒	Trigger lock
🔊	Buzzer
HOLD	Temperature hold
🔋	Low battery
ε= 0.88	Emissivity
MAX MIN AVG DIF	Measurement mode
HI LO	Temperature alarm
🔦	Laser
SCAN	Temperature measurement
°C °F	Temperature unit
8888	Temperature main display
8888	Temperature secondary display



Operating Instructions

Startup

Short press (less than 0.5s) the trigger to turn on the thermometer, and the measured value before the last shutdown will be displayed. Pressing MODE button can view MAX/MIN/AVG/DIF.

Shutdown

The thermometer will automatically shut down after 15 seconds without any operation in the HOLD mode, and save the current measured value.

Manual Measurement

- 1) After aiming at the measured object, press the trigger and hold it. When the SCAN symbol is flashing, it means that the temperature is being measured, and the measurement result will be updated on the LCD.
- 2) Release the trigger, the SCAN symbol will disappear while the HOLD symbol will be displayed. The thermometer will stop measuring the temperature and keep the last measured value.

Lock Measurement


- 1) Short press the LOCK button to enter the lock measurement mode. The 🔒 symbol will be displayed on the LCD and the SCAN symbol will flash. The thermometer will measure the target temperature continuously without pressing the trigger all the time.
- 2) Press the trigger or short press the LOCK button again, the 🔒 and SCAN symbols will disappear while the HOLD symbol will appear. The thermometer will stop measuring and keep the last measured temperature.
- 3) Short press the LOCK button in the shutdown state to wake up the thermometer and enter the lock measurement mode.
- 4) If the LOCK button is pressed and not released for more than 3 seconds, it will be regarded as a misoperation.

Note: The measured target should be greater than 2 times the thermometer light spot diameter (S), and then the test distance (D) can be determined according to the D: S relationship diagram.

For example: when the user uses UT306C to measure the temperature of an object with a diameter of about 4" (10cm), the most accurate spot diameter (S) of the thermometer is about 2" (5cm), and then it can be estimated based on the D:S relationship diagram that the measuring distance (D) is about 24" (60cm).

MAX/MIN/AVG/DIF Value

Short press the "MODE" button to switch among "MAX→MIN→AVG→DIF" measurement modes in sequence, and the temperature of the corresponding mode will be displayed in the secondary display position (as shown below).

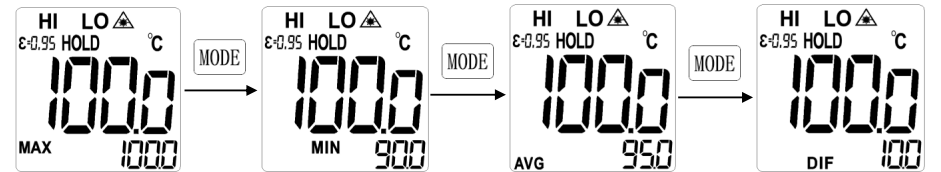

Laser Indicator

Pressing the 🔦 button can turn on/off the laser indication function. When it is turned on, the laser symbol 🔦 will show on the LCD, and the laser will accurately indicate the measured position.

Note: Please follow the cautions when turning on the laser to avoid eyes injury.

High and Low Temperature Alarm

If the measured temperature is higher than the set high alarm limit, the HI symbol on the display will flash. If the sound alarm is turned on, the buzzer will beep.

If the measured temperature is lower than the set low alarm limit, the LO symbol will flash. If the sound alarm is turned on, the buzzer will beep.


If the measured temperature value is within the range of high and low alarm limit, the HI/LO symbol will not show on the display.

Function Settings

In the HOLD interface, long press the "MODE" button for more than 2s to enter the high alarm limit →low alarm limit→emissivity→temperature unit→sound alarm and other function settings. Under these setting interfaces, the user can return to the HOLD interface by pressing the trigger or no operation for 10s.


High Alarm Limit Setting

In the HOLD interface, long press the "MODE" button to enter the high alarm limit setting interface. The user can use "▼" or "▲" to adjust. Short pressing will add or subtract 1 to the value each time, and long pressing will add or subtract 10 each second.

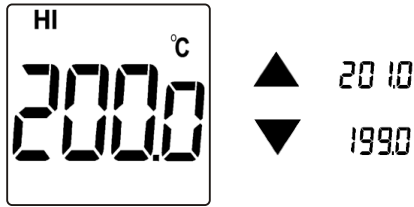


Low Alarm Limit Setting

In the HOLD interface, long press and then short press the "MODE" button once to enter the low alarm limit setting interface. The user can use "▼" or "▲" to adjust. Short pressing will add or subtract 1 to the value each time, and long pressing will add or subtract 10 each second.

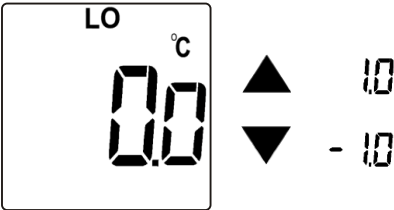

Emissivity Setting

In the HOLD interface, long press the "MODE" button once and then short press the "MODE" button twice to enter the emissivity setting interface. The user can use "▼" or "▲" to adjust. Short pressing will add or subtract 0.01 to the value each time, and long pressing will add or subtract 0.1 each second.

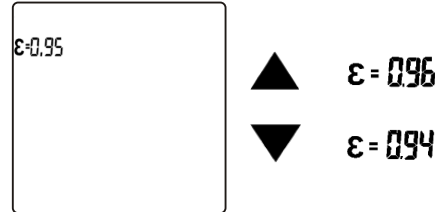

Temperature Unit Setting


In the HOLD interface, long press the "MODE" button once and then short press the "MODE" button three times to enter the temperature unit setting interface. The user can use "▼" or "▲" to convert the unit °C/°F.

Sound Alarm Setting

In the HOLD interface, long press the "MODE" button once and then short press the "MODE" button four times to enter the sound alarm setting interface. The user can use "▼" or "▲" to turn on/off this function.


D: S (Distance to Spot Ratio)

As the distance (D) between the thermometer and the measured target increases, the light spot diameter (S) of the measured area also increases. The relationship between measurement distance and light spot diameter is shown in the figure below.

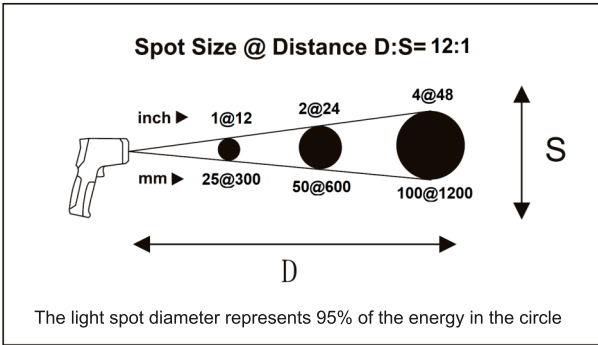

Field of View

When measuring, make sure that the measured target is larger than the light spot diameter. The smaller the target, the closer the test distance should be (refer to D: S for the detailed light spot diameter). It is recommended that the measured target be larger than twice the light spot diameter of the thermometer.

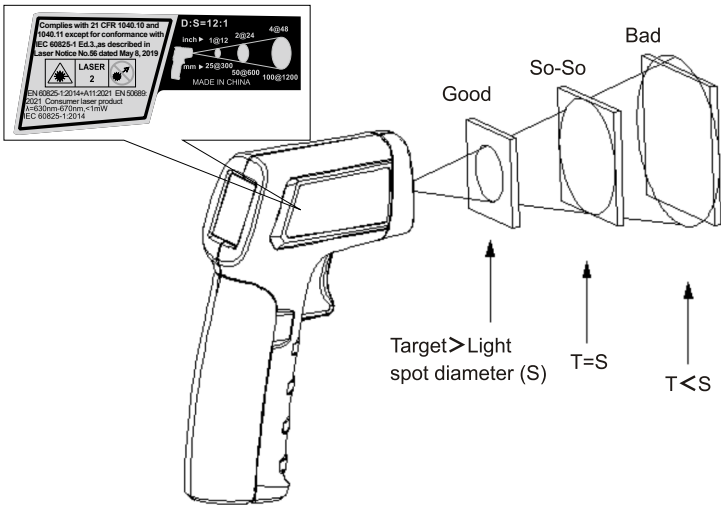

Emissivity

Emissivity represents the material energy radiation. The emissivity of most organic materials, painted or oxidized surfaces is about 0.95. The user can use masking tapes or flat paints to cover the metal surface, use the high emissivity setting, and then wait for a period of time to make the surface temperatures of the tapes/flat paints and the covered object the same. At this point, the surface temperature of the tapes /flat paints is equal to the metal surface temperature. The following table shows the total emissivity ε of some metals and non-metals.

Measured surface	Emissivity
Metals	
Aluminum Oxide	0.2-0.4
A3003 Alloy Oxide Crude	0.3 0.1-0.3
Brass Polishing Oxide	0.3 0.5
Cuprum Oxide Electrical terminal board	0.4-0.8 0.6
Hastelloy Alloy	0.3-0.8
Inconel Oxide Abrasive blasting Electropolishing	0.7-0.95 0.3-0.6 0.15
Ferrum Oxide Rusting	0.5-0.9 0.5-0.7
Ferrum (casting) Oxide Non-Oxide Casting	0.6-0.95 0.2 0.2-0.3
Ferrum (forging) Passivating	0.9
Plumbum Crude Oxide	0.4 0.2-0.6
Molybdenum Oxide	0.2-0.6
Nickel Oxide	0.2-0.5
Platinum Black	0.9
Steel Cold rolling Burnishing Polishing	0.7-0.9 0.4-0.6 0.1

Zinc Oxide	0.1
Non-Metals	
Asbestos	0.95
Asphalt	0.95
Basalt	0.7
Carbon Non-Oxide Graphite Carborundum	0.8-0.9 0.7-0.8 0.9
Ceramic	0.95
Clay	0.95
Concrete	0.95
Cloth	0.9
Glass Convex glass Smooth glass Nonex	0.76-0.8 0.92-0.94 0.78-0.82
Sheet material	0.96
Gypsum	0.8-0.95
Ice	0.98
Limestone	0.98
Paper	0.95
Plastic	0.95
Water	0.93
Soil	0.9-0.98
Wood	0.9-0.95

Maintenance


Cleaning

Blow away the fallen particles with clean compressed air, carefully wipe the lens surface with a moist swab, and clean the shell with a moist sponge or soft cloth. Be careful not to rinse with water or immerse it in water.

Replace Batteries

Install or replace two 1.5V batteries according to the following steps:

1. Remove the battery door
2. Install the batteries (pay attention to the polarity)
3. Close the battery door

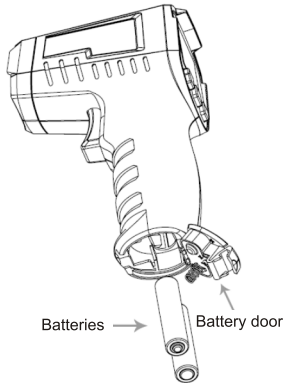

Troubleshooting

Phenomenon	Cause	Measure
Display OL	Measured value>maximum range	Stop measuring
Display -OL	Measured value<minimum range	Stop measuring
Display Err (startup)	Exceed the minimum or maximum operating temperature	Place the thermometer at 0°C-50°C (32°F-122°F) for 30 minutes
Battery symbol flashes	Low battery	Replace batteries
Laser is not working or dark	Low battery	Replace batteries
Inaccurate measurement	Unmatched emissivity, too far measurement distance, diameter of the measurement target<20mm	Refer to Field of View, D:S and other instructions in this manual

The contents of this manual are subject to change without prior notice

UNI-T®
UNI-TREND TECHNOLOGY (CHINA) CO., LTD.

No. 6, Gong Ye Bei 1st Road,
Songshan Lake National High-Tech Industrial
Development Zone, Dongguan City,
Guangdong Province, China



Warnings and safety information

For all information on handling and use, please refer to the instruction manual or product label. Before using the products, read its contents and follow the instructions contained therein.

Also read the following information before use:

Safety of use

1. Use measuring tools for their intende purpose. Do not use measuring tools for tasks for which they were not designed to avoid damage or erroneous measurement results.
2. Always make sure a tool is in good working condition before using it. Damaged tools, such as cracked cases or damaged displays, can lead to incorrect measurements or risk of accidents.
3. Calibrate measuring tools regularly to ensure accuracy and reliability of measurements. Incorrectly calibrated devices can lead to erroneous results.

Precautions

1. Use appropriate eye protection, especially when working with measuring tools that may emit radiation.
2. Keep measuring tools away from children and untrained people to prevent accidental damage or misuse.
3. Avoid using measuring tools in extreme conditions of temperature, humidity or in an atmosphere with a high concentration of dust, which can affect their accuracy and functionality.
4. Be careful not to damage delicate measuring components (e.g., sensors, probes) when working with measuring tools.

Safe use

1. Always make sure that the measurin tool is properly aligned and fixed to avoid measurement errors or damage.
2. Use measuring tools only in designated areas that provide adequate stability and minimize the risk of accidents, such as slippery or uneven surfaces.
3. Never take measurements on live components or in conditions that may pose a safety hazard.

Rules for use in appropriate conditions

1. Store measuring tools in a dry, cool place, away from moisture and direct sunlight, which can damage the devices or affect their accuracy.
2. When using measuring tools, make sure they are well seated and will not be subjected to shocks or impacts that can damage them.
3. Avoid using measuring tools in areas with extreme conditions, such as high vibration, hot surfaces, dust, or moisture, unless the tool is rated for this by the manufacturer.

Maintenance instructions

1. Regularly check the condition of measuring tools, especially measuring components (e.g., sensors, probes, displays) and batteries.
2. Follow the cleaning instructions provided by the manufacturer. Use appropriate cleaning materials (e.g., soft cloths) to avoid damaging delicate components.
3. Calibrate measuring tools regularly, according to the manufacturer's recommendations, to maintain measurement accuracy.

Safe disposal

1. Dispose of used or damaged measuring tools in accordance with current environmental and electronics recycling regulations.
2. Do not dispose of measuring tools in regular waste containers, as they may contain elements harmful to the environment.
3. Contact local authorities or recycling companies for information on proper disposal of used measuring tools.

Statement of compliance

The products have been designed in accordance with the safety requirements of **Regulation (EU) 2023/988** on general product safety, ensuring their compliance with applicable standards for the safety and health protection of users.

EU REP

UNI-TREND TECHNOLOGY EU GMBH

Affinger Strasse 12 86167 Augsburg,

Germany